



## Memorandum

**To:** Bassett Creek Watershed Management Commission (BCWMC)  
**From:** Barr Engineering Co.  
**Subject:** Bassett Creek 2022 Flood Control Project Inspection  
**Date:** November 9, 2022  
**Project:** 23270051.53 2022 4065

In accordance with the Operation and Maintenance Manual for the Bassett Creek Flood Control Project (FCP), an annual inspection is required to review the condition of the FCP features. The FCP was turned over to the local sponsor during 2002. Therefore, inspection of the FCP features was initialized during the fall of 2002, which was the first formal inspection by the Bassett Creek Watershed Management Commission (BCWMC). Except as noted, the annual inspections have been performed from 2002-2022. Inspections were not performed during 2003, 2011, and 2013 due to BCWMC budget considerations. Some of the municipalities have performed independent inspections of several of the FCP structures. The municipalities are responsible for routine maintenance and repair of the BCWMC FCP features located within their city. The municipalities are also responsible for submitting the completed FCP Maintenance Record from the previous year's inspection. It is important that the BCWMC receive these records, as the inspection and reporting are essential to ensure the BCWMC/municipalities maintain their eligibility to receive federal funds to repair or replace FCP features in the event of a catastrophe.

Pursuant to BCWMC policy, the municipalities may request reimbursement from the BCWMC for major maintenance and repairs that exceed \$25,000. However, the municipalities must perform regular, routine maintenance and submit the required reporting before requesting and receiving BCWMC reimbursement. This will help prevent the situation wherein the BCWMC pays for maintenance work over \$25,000 because the municipalities neglected routine maintenance for several years. The BCWMC expects the municipalities to inform the Commission in advance (e.g., two years) of their request for reimbursement. The BCWMC will consider adding maintenance and repair projects that are more than \$100,000 to the BCWMC CIP.

Table 1 (at the end of this memo) provides examples of maintenance and repairs that are major or could be major. In addition, the cities (or other road authority) where the FCP features are located are responsible for maintenance, repair and replacement of road crossings, and their corresponding conveyance structures, which were installed as part of the FCP.

The following are the 2022 inspection comments and recommendations:

## Plymouth Features

Inspection Date: October 21, 2022

Inspection Personnel: Patrick Brockamp and Josh Phillips (Barr)

### 1. Plymouth Creek Fish Barrier (Constructed 1987)

- a. There was no flow overtopping the weir or in the creek.
- b. The structure appeared to be in satisfactory condition.
- c. The water level was 2.4 feet below the weir at the time of the inspection.
- d. Sediment has accumulated in the pool upstream of the structure and formed a delta, which was overgrown with vegetation. The deposited sediment was generally creating a meander in the creek toward the east (left) bank. Deposited sediment in the upstream pool has been noted since 2005. Deposited sediment also existed at the structure as shown in the photos.
- e. The railings at the upstream end of the structure, on the east (left) and west (right) sides, have rusted off below the weir level. This is consistent with previous inspections and has been noted since 2015.
- f. The abutment walls have expansion joints in the middle, just upstream of the weir. The west (right) expansion joint gap was first measured in 2002 at 7/8 inches for comparison with future inspections. The west (right) expansion joint gap was measured at 7/8 inches this year.
- g. The top downstream edge of the concrete pile cap forming the weir has deteriorated along its entire length. Deterioration includes loss of cement paste and fines resulting in exposed aggregate. The weir appears to be functioning properly and controlling water to the design elevation.
- h. Three cracks were observed on the downstream west (right) wing wall. This is consistent with previous inspections and has been noted since 2004.
- i. Seven diagonal cracks were observed on the downstream east (left) wing wall. Three of the cracks are more prominently defined, closed cracks. Observation of the three prominent cracks is consistent with previous inspections and has been noted since 2002. The other four cracks are generally closed hairline cracks and less noticeable.
- j. A 14-inch diameter tree was observed growing adjacent to the downstream east (left) wing wall and through the railing.
- k. Small trees and shrubs were observed growing on the embankment and downstream channel banks, including some near the wing walls and railings.

#### Recommended Action:

- Remove accumulated sediment at structure and from the upstream pool. (Note: In 2010, the City of Plymouth submitted an Environmental Assessment Worksheet (EAW) to the Minnesota Pollution Control Agency (MPCA) for a channel improvements project. The MPCA informed

Note: references to "right" and "left" are with respect to facing downstream.

- the City of Plymouth that the Clean Water Act expressly prohibits the use of creeks, streams, lakes, and wetlands from being used as a pollution treatment system except in extreme situations, therefore dredging of the sediment upstream of the fish barrier, in order to continue to utilize the area upstream of the fish barrier as a sedimentation pond, was prohibited by the MPCA and not permitted. It is recommended that the City of Plymouth coordinate with the MPCA to revisit this issue or discuss viable alternatives to remove the sediment since the project intent was not as a sediment basin but as a fish barrier.)
- Remove trees and vegetation on embankment and channel banks. Chemically treat stumps with Garlon 3A herbicide (or other specialty herbicide for use in wetland sites and waterways) to prevent regrowth.
  - Monitor concrete cracks and the width of the expansion joints.

## **2. Medicine Lake Outlet Structure (Constructed 1996)**

- a. There was no flow passing over the weir or the channel between Medicine Lake and the outlet structure was dry and clear of debris.
- b. The outlet structure appeared to be in satisfactory condition.
- c. The staff gauge was "in the dry" due to "no flow" conditions during the inspection.
- d. Although not part of the flood control project, the storm sewer outfall for local drainage from South Shore Drive in the west (right) bank was nearly full of sediment.
- e. Woody vegetation was observed at either end of the dam where it ties into the banks.
- f. In late May 2019, City of Plymouth staff observed water flowing over the east side, but not the west side, of the Medicine Lake Outlet Structure. The city performed a baseline survey of the dam in the summer of 2019 and found that the east side of the dam was 0.15 feet lower than the west side. Future surveys can be performed to compare against the baseline.

### Recommended Action:

- Remove woody vegetation on either end of the dam where it ties into the banks.
- Although not part of the flood control project, the city may want to consider jetting out the sediment that has accumulated in the storm sewer that provides local drainage from South Shore Drive.

## **Golden Valley Features**

Inspection Date: October 21, 2022

Inspection Personnel: Patrick Brockamp and Josh Phillips (Barr), Drew Chirpich and Matthew Jefferson (City of Golden Valley)

### **1. Wisconsin Avenue Control Structure (Constructed 1987)**

- a. The water level was below the lowest staff gauge reading upstream and downstream of the culvert.

Note: references to "right" and "left" are with respect to facing downstream.

- b. The flood gate was closed (down) at the time of the inspection and appeared to be in satisfactory condition.
- c. Deposited sediment was observed in the bottom of the culvert, ranging from 0-2 inches deep. The deposited sediment is consistent with previous inspections and has been noted since 2006.
- d. Some of the gabion baskets upstream and downstream of the culvert have deteriorated or broken and riprap had fallen out of the baskets at some locations. Although the gabion baskets are no longer functioning as installed, no significant erosion was observed. There is evidence of some minor erosion near the staff gauge.
- e. The railings at the upstream and downstream ends of the culvert were in satisfactory condition.
- f. City of Golden Valley staff cleared brush at both the upstream and downstream ends of the culvert.

Recommended Action:

- Monitor deposited sediment in the culvert.
- Monitor upstream and downstream banks for erosion.

**2. Golden Valley Country Club – Box Culvert, Overflow Weir, and Downstream Channel (Constructed 1994)**

- a. The channel and riprap armoring from Pennsylvania Avenue to the box culvert appeared to be in satisfactory condition.
- b. The box culvert, joints, and railings appeared to be in satisfactory condition.
- c. The overflow weir (earth berm) appeared to be in satisfactory condition and has been maintained by the Golden Valley Country Club staff as manicured fairway turf.
- d. Some sediment deposition was observed on the north (left) bank just upstream of the box culvert on top of the riprap, consistent with previous years.
- e. Some sediment deposition in other upstream areas was observed. This may have been due to low water levels.
- f. A new outfall into the creek has been installed from the development north of the creek along Pennsylvania Avenue.

Recommended Action:

- Monitor sediment deposition on the north (left) bank just upstream of the box culvert.

**3. Westbrook Road Crossing (Constructed 1993)**

- a. The concrete Bebo culvert appeared to be in satisfactory condition.
- b. In 2022, City of Golden Valley staff repaired the spalled concrete and exposed rebar that were previously observed around the storm sewer pipe entering the culvert on the west (left) side.

Note: references to "right" and "left" are with respect to facing downstream.

- c. In 2022, City of Golden Valley staff repaired deteriorating grout and adjusting rings in the downstream east (right) catch basin.
- d. Longitudinal hairline cracks were observed on the top of sections of the Bebo culvert, extending across the entire section (pre-cast section) width. The cracks are approximately 2 feet off-center of the structure. These cracks are consistent with previous inspections and have been noted since 2002.
- e. A joint gap and separation were observed between the two furthest downstream sections of the culvert and there are signs of pressure points where the last section has pushed against the top of the two wing walls.
- f. Spalled concrete was observed at multiple locations upstream and downstream of the culvert at the top of the wing walls and head wall. This is consistent with previous inspections and has been noted since 2007.
- g. Westbrook Road over the culvert was repaved in 2022.
- h. The railings appeared to be in satisfactory condition.

Recommended Action:

- Monitor cracks in the culvert.
- Monitor joint gap at pressure points.
- Monitor spalled concrete at wing walls and head walls.

**4. Regent Avenue Crossing (Constructed 1981-1984)**

- a. The concrete Bebo culvert appeared to be in satisfactory condition.
- b. The channel bottom was soft and mucky, and the water level was below the bottom of the staff gauge and not measured.
- c. Spalled concrete was observed at the middle joint of the upstream north (left) wing wall. This is consistent with previous inspections and has been noted since 2002.
- d. A crack was observed at the upstream north (left) wing wall. The crack was near the top of the wing wall and travels at a 45-degree angle down to the headwall. This is consistent with previous inspections and has been noted since 2002.
- e. Multiple cracks were observed at the upstream south (right) wing wall. This is consistent with previous inspections and has been noted since 2008.
- f. A crack was observed at the downstream south (right) wing wall. The crack was near the top of the wing wall and travels at a 45-degree angle down to the headwall. This is consistent with previous inspections and has been noted since 2002.
- g. Flows appeared to have scoured the north (left) side of the creek bottom and deposited sediment on the south (right) side of the creek bottom.
- h. The railings appeared to be in satisfactory condition.

Recommended Action:

- Monitor spalled concrete at the upstream north (left) wing wall.

Note: references to "right" and "left" are with respect to facing downstream.

- Monitor crack at the upstream north (left) wing wall.
- Monitor cracks at the upstream south (right) wing wall.
- Monitor crack at the downstream south (right) wing wall.
- Monitor creek bottom for scouring and deposition and, as needed, armor creek bottom along culvert foundation.

**5. Noble Avenue Crossing (Constructed 1981-1984)**

- a. The concrete Bebo culvert appeared to be in satisfactory condition.
- b. Longitudinal hairline cracks were observed throughout the length of the top of the culvert, extending across the entire (pre-cast) section width. The cracks were either in the center of the structure or approximately 2 feet off-center of the structure. This is consistent with previous inspections and has been noted since 2002.
- c. Spalled concrete and exposed plastic joint material were observed approximately two feet either side of center throughout the length of the top of the culvert. The cement paste covering the plastic joint material has separated and exposed the plastic. This is consistent with previous inspections and has been noted since 2002.
- d. Spalled concrete was observed at the downstream north (left) wing wall. This is consistent with previous inspections and has been noted since 2002.
- e. Multiple cracks and spalling were observed at the top of downstream north (left) wing wall. The cracking is consistent with previous inspections and has been noted since 2007.
- f. The downstream south (right) wing wall was slightly leaning toward creek. Inspection staff have monitored the offset between the upper portion of the wing wall and the lower portion of the wing wall, which is leaning toward the creek, since 2002 to document movement. The inspection staff's measurements are listed below:

<b>Year*</b>	<b>2002</b>	<b>2004</b>	<b>2005</b>	<b>2006</b>	<b>2007</b>	<b>2008</b>	<b>2009</b>	<b>2010</b>	<b>2012</b>
Offset	5/8"	5/8"	11/16"	1"	1"	1"	1-1/8"	1-1/8"	1-1/8"
<b>Year*</b>	<b>2014</b>	<b>2015</b>	<b>2016</b>	<b>2017</b>	<b>2018</b>	<b>2019</b>	<b>2020</b>	<b>2021</b>	<b>2022</b>
Offset	1-1/8"	1-1/8"	1-1/8"	1-1/8"	1-1/8"	1-3/16"	1-3/16"	1-1/2"	1-5/16"

\* FCP inspection was not performed in 2003, 2011, or 2013 due to budget considerations.

- g. Minor bank erosion and scour was observed on both sides of the downstream wing walls. This is consistent with previous inspections and has been noted since 2002.
- h. Flows appeared to be scouring the north (left) side of the creek bottom.
- i. The railings appeared to be in satisfactory condition.
- j. The City of Golden Valley installed riprap in 2018 to reinforce the bank and minimize continued erosion at the outside edge of the upstream south (right) wing wall, however some erosion has perpetuated upstream.
- k. There are some downed trees in the creek channel downstream of the culvert.

Note: references to "right" and "left" are with respect to facing downstream.

Recommended Action:

- Remove downed trees in the creek channel downstream of the culvert.
- Monitor cracks and spalled concrete in the culvert and wing walls.
- Monitor bank erosion at downstream wing walls and upstream of installed riprap at upstream south (right) wing wall.
- Monitor creek bottom for scouring and, as needed, armor creek bottom along culvert foundation.

**6. Highway 55 Control Structure (Constructed 1987)**

- a. The concrete control structure appeared to be in satisfactory condition.
- b. A hairline crack was observed in the east (left) wall of the inlet structure, although it appears that the crack may have been previously sealed with caulk. The crack is positioned in the middle of the wall extending full height. This is consistent with previous inspections and has been noted since 2002.
- c. Erosion was observed around the east (left) side of the structure, likely from road runoff. In the summer of 2021, Minnesota Department of Transportation (MnDOT) crews placed class 5 aggregate on the east (left) side of the structure to access the upstream end of the structure to perform repairs of the double box culvert below Highway 55. The new class 5 aggregate is actively eroding.
- d. MnDOT crews also drilled holes into the structure to install brackets and a temporary plate to block flows through the structure so they could perform repairs. MnDOT removed the plate, brackets, and bolts, but did not fill or repair the bolt holes.
- e. A piece of rebar and relatively small mass of concrete extended into the lower west (right) side of the opening of the low flow weir. A steel threaded rod extended approximately 2 inches from the south face of concrete on the east (left) side of low flow weir. These observations have not been noted in previous years' inspections, but water levels were lower in 2021 and 2022 than previous years, exposing this part of the structure.

Recommended Action:

- Protect the sides of the structure with armoring (rock or riprap) or reinforced vegetation to limit additional erosion. Alternatively, divert road runoff away from the structure.
- Request that MnDOT repair bolt holes with concrete grout.
- Sawcut and remove rebar and concrete chunk on east (left) side of low flow weir.
- Sawcut steel rod to be flush to concrete along south face of concrete on the east (left) side of the low flow weir.
- Monitor hairline crack in the control structure.

Note: references to "right" and "left" are with respect to facing downstream.

## Crystal Features

Inspection Date: October 21, 2022

Inspection Personnel: Patrick Brockamp and Josh Phillips (Barr)

### 1. Markwood Open Channel – Gabion Section (Constructed 1981-1984)

- a. The channel appeared to be in satisfactory condition.
- b. Significant tree and vegetation growth was observed in the gabion section of the channel and the gabion wire is at risk of damage.

Recommended Action:

- Clear woody vegetation growing through the gabions and chemically treat stumps with Garlon 3A herbicide (or other specialty herbicide for use in wetland sites and waterways) to prevent regrowth and protect gabion wire. Consider clearing vegetation every 1-2 years to protect gabion wire, maintain flow capacity, and allow access through the open channel.

### 2. Markwood Open Channel (Constructed 1981-1984)

- a. The channel appeared to be in satisfactory condition.
- b. Vegetation growth was observed along the side slopes of the channel. Some areas appeared to have been cleared since the previous year's inspection.
- c. Erosion was observed along the toe of the north (left) and south (right) banks. This is consistent with previous inspections and has been noted since 2006.
- d. Some homeowner retaining walls and fences along the channel were leaning toward the channel and, in some cases, appeared to be failing. This is consistent with previous inspections and has been noted since 2009.
- e. The City of Crystal's corrugated metal pipe (CMP) storm sewer, discharging into the channel between 6833 and 6825 Markwood Drive, was in poor condition. The pipe bottom was corroded and there was erosion and undercutting around the pipe end. The pipe was exposed 8 feet, 3 inches, measured on the downstream side.

Recommended Action:

- Clear woody vegetation in the channel. Consider clearing vegetation every 3-5 years to maintain flow capacity and allow access through the open channel.
- Monitor erosion along the toe of the channel banks.
- Although not part of the flood control project, monitor retaining walls and fences for potential failure and obstruction of flow through the channel.
- Although not part of the flood control project, the city may want to consider repairing or replacing the CMP storm sewer.

### 3. 36<sup>th</sup> Avenue and Hampshire Avenue Crossing – 8 feet x 6 feet Double Box Culverts (Constructed 1981-1984)

Note: references to "right" and "left" are with respect to facing downstream.



- a. The concrete box culverts, joints and tie bars appeared to be in satisfactory condition.
- b. Riprap has deposited in the box culverts. Some may have washed through the culvert since last year's inspection.
- c. Sediment has deposited in the box culverts, mostly in the downstream half of the box culverts. This is consistent with previous inspections and has been noted since 2016.
- d. On both culverts, the fifth joint from the downstream end had a 2 ½ inch gap, which is a larger gap than the rest of the joints. This is consistent with previous inspections and has been noted since 2010.
- e. Various locations of spalled concrete and exposed reinforcing was observed through both culverts.
- f. Infiltration was observed into the culvert in some years in the past, but no infiltration into the culvert was observed in 2022 due to low water levels and dry conditions.

Recommended Action:

- Remove deposited riprap in the box culverts and replace upstream.
- Monitor sediment in the box culverts.
- Monitor the joint gaps in the box culverts.
- Monitor spalled concrete, and exposed reinforcing in the culverts.

**4. Markwood Downstream Overflow (Constructed 1981-1984)**

- a. The overflow was in satisfactory condition.

Recommended Action:

- None

**5. Markwood 8 feet x 4 feet Box Culvert (Constructed 1981-1984)**

- a. This culvert was not entered and was visually inspected from the outside at the downstream end. No obstructions or significant sedimentation was observed, and the box culvert appeared to be in satisfactory condition.

Recommended Action:

- None

**6. Georgia Avenue Crossing (Constructed 1981-1984)**

- a. The concrete culverts appeared to be in satisfactory condition.
- b. Cracking and potential spalling was observed in the south (right) culvert at the second and fourth joints at approximately the five o'clock position.
- c. Minor erosion was observed between the concrete culverts at the upstream end.
- d. Both culverts appeared to begin to change slope around mid-channel.
- e. There is a downed tree upstream of the culvert that is partially in the creek.
- f. Some riprap has deposited in the north (left) culvert.

Note: references to "right" and "left" are with respect to facing downstream.

Recommended Action:

- Remove deposited riprap in the north (left) culvert and replace upstream.
- Monitor cracking and potential spalling in the south (right) culvert.
- Monitor minor erosion between the concrete culverts on the upstream end.

**7. Edgewood Embankment (Constructed 1981-1984)**

- a. The concrete culvert appeared to be in satisfactory condition.
- b. The embankment appeared to be in satisfactory condition.
- c. No visible settlement or erosion was observed along the embankment.
- d. Trees and shrubs were observed growing on the embankment.
- e. Three large trees (two oak trees and one maple tree) have fallen downstream of the culvert and the tree branches are extending into the creek channel and could obstruct creek flows.
- f. The natural boulder riprap between the Edgewood embankment and Douglas Drive crossing is significantly overgrown with vegetation.
- g. Spalled concrete was observed at the fifth joint from the upstream end at approximately the 7 o'clock position.
- h. Spalling observed on north (right) side of outlet.
- i. Moderate erosion is occurring on either side of the upstream end of the culvert.
- j. Sediment has accumulated in the pool downstream of the culvert and formed a delta, which had some vegetation growing on it. The deposited sediment was generally creating a meander in the creek toward the south (right) bank.

Recommended Action:

- Remove branches and downed trees that are in the creek channel and could obstruct creek flows.
- Remove trees, shrubs and woody vegetation growing on the embankment.
- Clear woody vegetation in the channel between the Edgewood Embankment and Douglas Drive crossing as needed to maintain flow capacity and allow access through the open channel.
- Monitor spalled concrete at the fifth joint from the upstream end in the culvert.
- Monitor spalling on outlet structure.
- Monitor sediment accumulation in the pool downstream of the culvert.

**8. Douglas Drive Crossing (Constructed 1981-1984)**

- a. The concrete box culvert was not entered due to low clearance but appeared to be in satisfactory condition.
- b. The grouted riprap installed on either side of the box culvert outlet has started to deteriorate, and a gap has opened between the grout and the wall of the box culvert. This is consistent with previous inspections and has been noted since 2016.

Note: references to "right" and "left" are with respect to facing downstream.

- c. Spalled concrete was observed at the downstream north (left) wing wall.
- d. Sediment has deposited in the bottom of the culvert, ranging from 0-2 inches deep.
- e. Some riprap was observed in the culvert.
- f. On the downstream end of the culvert, settling was observed in the sidewalk on either side of the culvert.
- g. Small trees were observed growing adjacent to the structure at the downstream end.
- h. Although not part of the flood control project, the privately-owned CMP culvert downstream of the Douglas Drive crossing is in poor condition. Sagging of this culvert has been observed during inspections since 2009. The culvert is significantly bowing and settling has occurred on either side of the culvert, which is evident in the road pavement above the structure.

Recommended Action:

- Consider adding a safety railing along the sidewalk at the upstream and downstream end of the culvert.
- Remove riprap from the culvert and replace upstream.
- Monitor deposited sediment in the culvert.
- Monitor grouted riprap at the downstream end of the box culvert.
- Monitor spalled concrete at the downstream north (left) wing wall.
- Monitor settling in the sidewalk at the downstream end of the culvert.
- Although not part of the flood control project, it is recommended that the city coordinate with the property owner to repair or replace the culvert downstream of Douglas Drive.

**9. 34<sup>th</sup> Avenue Crossing (Constructed 1981-1984)**

- a. The concrete culvert appeared to be in satisfactory condition.
- b. Some riprap has deposited in the culvert.
- c. Sediment has deposited in the bottom of the culvert, ranging from 0-4 inches deep. This is consistent with previous inspections and 0-12 inches of sediment has been noted in the culvert since 2002.
- d. The tie bars directly upstream and downstream of the manhole connection to the culvert were rusty and flaking. This is consistent with previous inspections and has been noted since 2008.

Recommended Action:

- Remove riprap from the culvert and replace upstream.
- Monitor accumulated sediment in the culvert.
- Monitor tie bars directly upstream and downstream of the manhole connection to the culvert.

Note: references to "right" and "left" are with respect to facing downstream.

#### **10. Brunswick Avenue Crossing (Constructed 1981-1984)**

- a. Based on previous years' inspections, the north (left) culvert is at a slightly lower elevation at the upstream end and the north (left) culvert conveys a majority of low flows. However, the culverts were dry during this year's inspections.
- b. Strained and detached tie bars were observed in the north (left) culvert. One joint with broken tie bars was previously re-grouted by the City of Crystal, but the joint reopened and a 1-1/2 inch gap in the joint was observed during the 2008 inspection. A 3-inch gap in the joint has been noted since 2009.
- c. Spalled concrete and exposed reinforcing were observed in various locations in the south (right) culvert.
- d. Fractured pieces of concrete and grout were observed at various joints in both culverts.
- e. Longitudinal and circumferential cracks were observed in both culverts.
- f. Cracks were observed in the road pavement above the structure.
- g. Sediment has deposited in the channel between the Brunswick Avenue crossing and the 32<sup>nd</sup> Avenue crossing and created two deltas in the channel. The channel was armored with boulder riprap in 2014. The sediment delta has been observed since 2017.
- h. Two boulders had fallen out of place on the south (right) side of the natural boulder wall, between the Brunswick Avenue crossing and the 32<sup>nd</sup> Avenue crossing and were deposited in the channel bottom.

#### Recommended Action:

- Repair detached tie bars.
- Repair fractured concrete and grout at joints in the culverts.
- Replace boulders in the natural boulder wall between the Brunswick Avenue crossing and the 32<sup>nd</sup> Avenue crossing.
- Monitor deposited sediment and vegetation in the channel between the Brunswick Avenue crossing and the 32<sup>nd</sup> Avenue crossing.
- Monitor spalled concrete and exposed reinforcing in the culverts.
- Monitor minor cracks in the culverts and road.
- Monitor joint separation in north (left) side culvert.

#### **11. 32<sup>nd</sup> Avenue Crossing (Constructed 1981-1984)**

- a. The southwest (right) culvert is at a slightly lower elevation at the upstream end.
- b. The concrete culverts appeared to be in satisfactory condition. The culverts were only visually inspected from the outside at the upstream and downstream ends due to low clearance and high water levels.
- c. In previous years' inspections, water was observed seeping into the north (left) culvert through the bottom of the first joint at the upstream end of the culvert. Water appeared to be seeping below the culvert through the second joint and back into the culvert through the third joint. These observations indicate that the joints are not well sealed and

Note: references to "right" and "left" are with respect to facing downstream.

there is potential for loss of fines (piping) below the culvert. The culverts were dry during this year's inspections.

- d. Concrete erosion along the culvert invert was noted at the upstream side of the north (left) culvert and at the upstream joints.

Recommended Action:

- Seal the upstream joints along the invert of the north (left) culvert to minimize potential loss of material and settling.

## **12. Bassett Creek Park Pond and Outlet (Constructed 1995)**

- a. Bassett Creek Park Pond appeared to be in satisfactory condition.
- b. Sediment has deposited in the northwest corner of Bassett Creek Park Pond and formed multiple deltas, which are overgrown with trees and vegetation. This has been noted since 2006 and the sediment deposition appears to be increasing.
- c. The outlet pipes appeared to be in satisfactory condition.

Recommended Action:

- None

Additional Comments:

- Dredging of Bassett Creek Park Pond and upstream channel improvements (BCP-2) is included in the BCWMC CIP Table 5-3. The BCWMC completed a feasibility study for the dredging of Bassett Creek Park Pond and Winnetka Pond in May 2017. The City of Crystal dredged Winnetka Pond East in 2019. The Bassett Creek Park Pond dredging is included as a future BCWMC CIP project, pending funding.

## **13. Detention Pond and Outlet Structure (Constructed 1995)**

- a. The outlet structure appeared to be in satisfactory condition.
- b. The detention pond appeared to be in satisfactory condition, but a survey is needed to assess accumulated sediment.

Recommended Action:

- Survey the detention pond to determine if the pond has accumulated sediment.

## **Crystal / Golden Valley Features**

Inspection Date: October 21, 2022

Inspection Personnel: Patrick Brockamp and Josh Phillips (Barr)

### **1. Highway 100 Double Box Culverts (Constructed 1930s, and 2001) and Inlet Structure (Constructed 1995)**

- a. The concrete inlet structure appeared to be in satisfactory condition.

Note: references to "right" and "left" are with respect to facing downstream.

- b. Circumferential cracks and areas of spalled concrete with exposed reinforcement were observed in the north (left) box culvert.
- c. Longitudinal cracks, circumferential cracks, and areas of spalled concrete with exposed reinforcement were observed along the top of the south (right) box culvert. MnDOT performed repairs to the culverts in 2007, but cracks have been noted since 2008 and areas of concrete spalling have been noted since 2014.
- d. Deposited sediment was observed in the north (left) box culvert, generally ranging from 6-24 inches deep. This is consistent with previous inspections and 6-24 inches of deposited sediment has been observed in the north (left) box culvert since 2002.
- e. The outlet portion of the structure appeared to be in satisfactory condition.

Recommended Action:

- Monitor accumulated sediment in north (left) box culvert and consider future removal.
- Monitor cracking, spalling concrete, and exposed reinforcement in both box culverts.
- MnDOT should assess the defects and repair, as necessary.

## Minneapolis Features

Inspection Date: October 21, 2022

Inspection Personnel: Patrick Brockamp and Josh Phillips (Barr)

### 1. Open Channel (Constructed 1992)

- a. The open channel, from Van White Memorial Boulevard to the inlet structure, appeared to be in satisfactory condition.
- b. The banks were generally vegetated. Some areas had exposed soil and steep slopes but seemed stable and no obvious signs of bank erosion were noted.
- c. Sediment has deposited and formed a delta on the south (right) side of the channel between the debris barrier and inlet structure. Vegetation was growing on the delta and approximately one-quarter of the channel was blocked by the sediment, debris, and vegetation. This is consistent with previous years' observation.

Recommended Action:

- Remove accumulated sediment and debris on the south (right) side of the channel between the inlet structure and debris barrier.
- Monitor downed tree(s) and debris and remove as needed.

### 2. Debris Barrier (Constructed 1992)

- a. The debris barrier piles appeared to be in satisfactory condition.
- b. The cable was missing or broken in the center portion of the channel. The middle seven barrier piles did not have a cable attached. The cable should extend from end to end, attached at each post.

Note: references to "right" and "left" are with respect to facing downstream.

Recommended Action:

- Repair or replace the steel cable on debris barrier.
- Monitor for debris and remove as needed.

**3. Inlet Structure (Constructed 1992)**

- a. The concrete inlet structure appeared to be in satisfactory condition.
- b. Vertical cracks were observed in the concrete on either side of the structure.
- c. Cracks were observed near where the handrail posts are embedded.
- d. The railings appeared to be in satisfactory condition.
- e. Some of the vertical bars have been bent and projecting a slight bow but generally appeared to be in satisfactory condition.
- f. The inlet structure was clear of debris.

Recommended Action:

- Monitor for debris and clear as needed.
- Monitor cracks in the concrete inlet structure.

**4. Double Box Culvert (Constructed 1992)**

- a. The most recent inspection of the double box culvert was completed in 2019. Inspection of the double box culvert is on a 5-year interval with the next inspection scheduled for 2024.

**5. 3<sup>rd</sup> Avenue Tunnel (Constructed 1990)**

- a. The most recent detailed inspection of the 3<sup>rd</sup> Avenue Tunnel was completed in 2020. Inspection of the 3<sup>rd</sup> Avenue "deep" tunnel is on a 5-year interval, alternating between a detailed NAASCO inspection and a less comprehensive tunnel inspection, looking for significant changes without coding existing or new defects or preparing a detailed report. The next "less comprehensive" inspection is scheduled for 2025.

**6. 2<sup>nd</sup> Street Tunnel (Constructed 1979)**

- a. The most recent inspection of the 2<sup>nd</sup> Street Tunnel was completed in 2020. Inspection of the entire 2<sup>nd</sup> Street "deep" tunnel is on a 10-year inspection interval with the next detailed NAASCO inspection scheduled for 2030. Similar to the 3<sup>rd</sup> Avenue Tunnel a "less comprehensive" inspection of the unsubmerged portions of the tunnel is scheduled for 2025.

Note: references to "right" and "left" are with respect to facing downstream.

**Table 1: Routine vs. Major Maintenance and Repairs Items**

<b>Routine vs. Major Maintenance and Repairs – as Recommended by the TAC<sup>1</sup> and approved by the BCWMC<sup>2</sup></b>	
<b>Routine</b>	
1	Vegetation: removal of trees, removal of brush, chemical treatment of stumps, control of noxious weeds, establish vegetation on bare areas
2	Removal of debris: woody debris, riprap, trash from channel, inlets, culverts
3	Repair erosion; channels, inlet and outlet structures, culvert ends
4	Repair/replace riprap: on inlet and outlet ends of culverts, channels, banks
6	Remove sediment from channels, structures, culverts, etc.
10	Repair/maintain guard rails, handrails and fencing: remove rust, prime and paint, repair damaged rails and posts, replace rusted-out sections, repair cables, replace posts, repair chain link fence
12	Repair concrete pipe: repair joints, tie-bolts, spalling, connection to culverts, breakage
13	Repair/replace catch basins, manholes, casting assemblies, grates
14	Repair/maintain debris barrier: removal of debris, repair cables, replace poles
15	Repair/maintain tunnel inlet trash rack: repair/replace trash rack rods (loose or broken, vandalized, bent)
16	Street repairs: pavement, curb and gutter, cracks, depressions, settlement
<b>Major</b>	
5	Repair/replace gabion baskets
7	Remove sediment/dredge ponds, basins, etc.
17	Tunnel repairs: concrete and other repairs to the new Bassett Creek tunnel
<b>Could be major depending on extent</b>	
8	Repair scouring/undercutting at structures and culvert outlets
9	Repair concrete structures: cracking, spalling, breakage
11	Culverts/Bebo sections: joints, settlement, separation, concrete spalling, wing walls – movement and breakage

<sup>1</sup> Based on needed repairs identified during 2016 FCP inspection.

<sup>2</sup> Per BCWMC actions at their May 19, 2016 and July 21, 2016 meetings.

Note: references to “right” and “left” are with respect to facing downstream.



**Attachment**

**Photographs of Bassett Creek Flood Control Project Features**

**October 21, 2022**

Plymouth Creek Fish Barrier (Plymouth)



Medicine Lake Outlet (Plymouth)



Wisconsin Avenue Control Structure (Golden Valley)




# Golden Valley Country Club (Golden Valley)




Westbrook Road Crossing (Golden Valley)



Regent Avenue Crossing (Golden Valley)

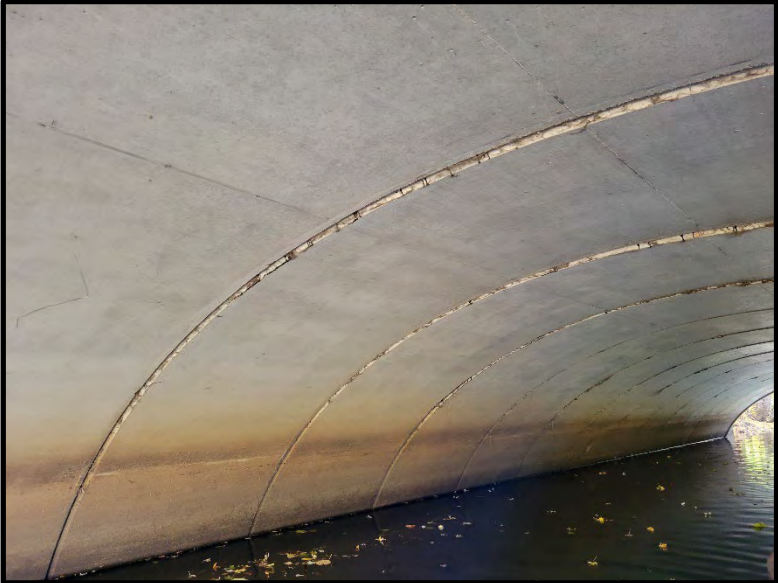

Noble Avenue Crossing (Golden Valley)


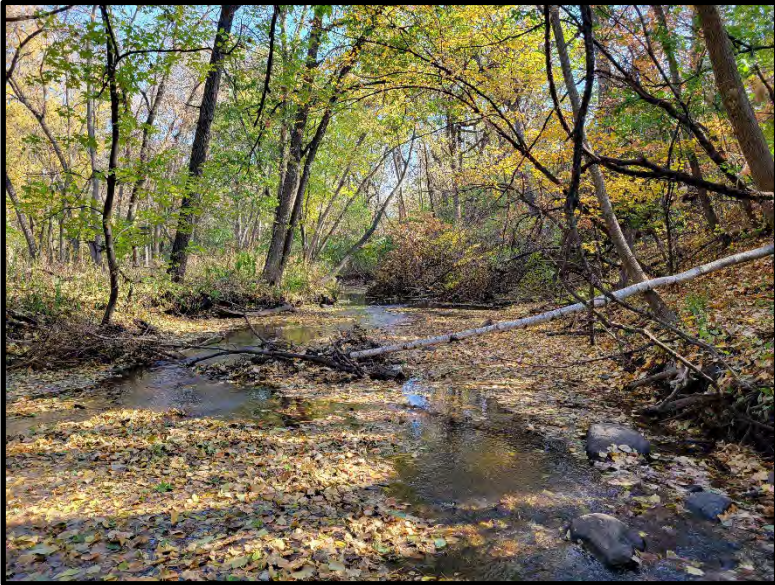






Highway 55 Control Structure (Golden Valley)




Markwood Open Channel - Gabion Section (Crystal)

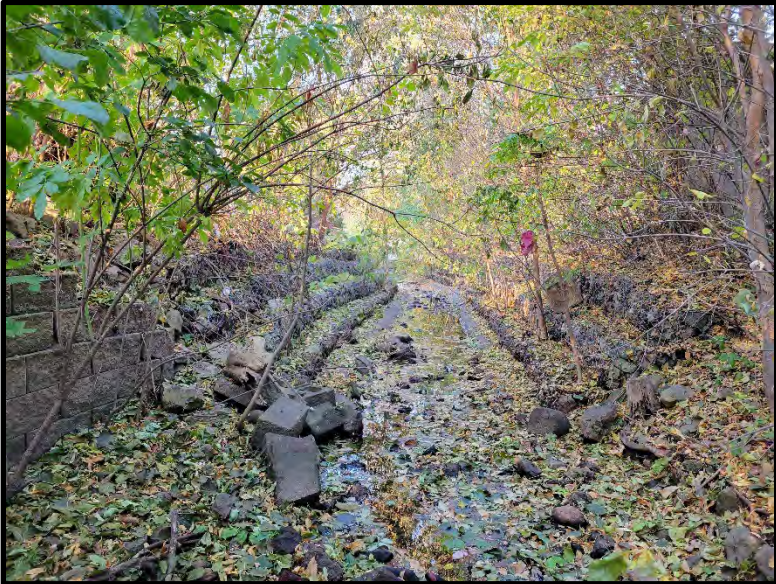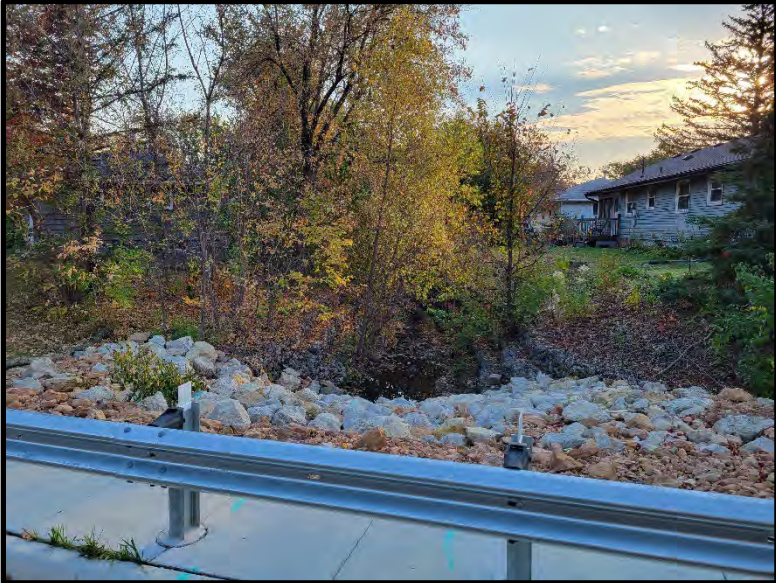

Markwood Open Channel (Crystal)

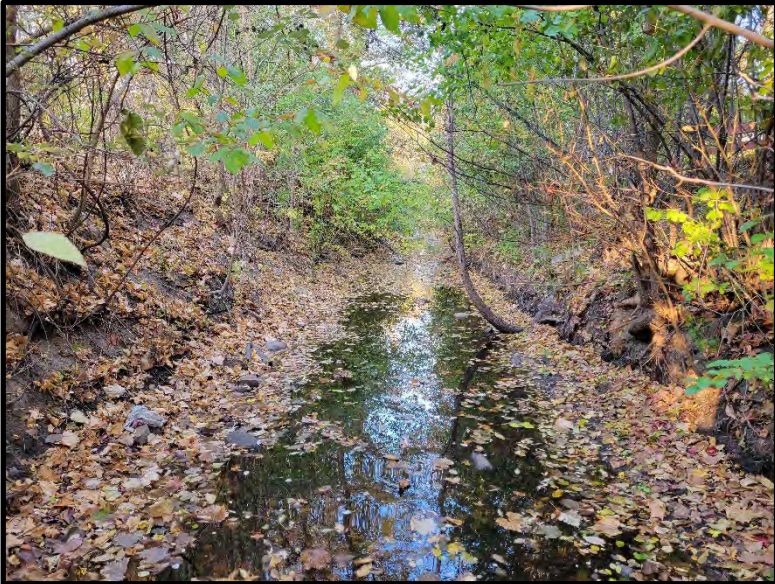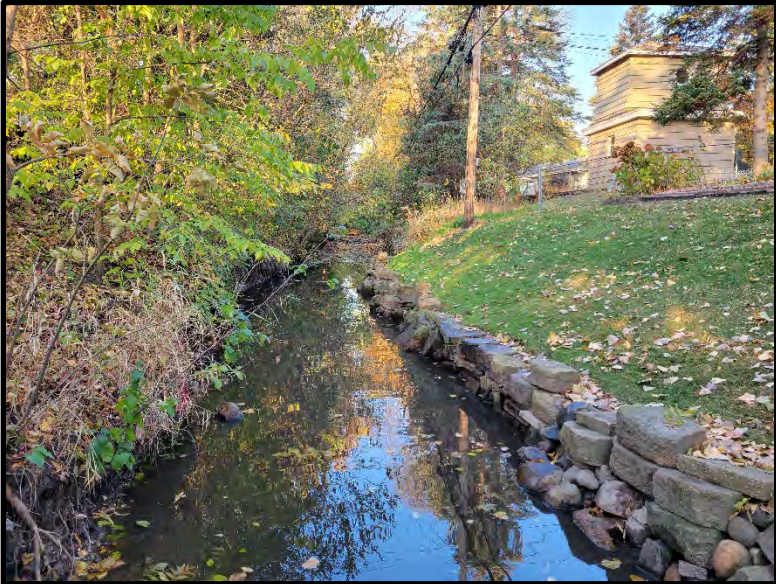

36th Avenue and Hampshire Avenue Crossing (Crystal)

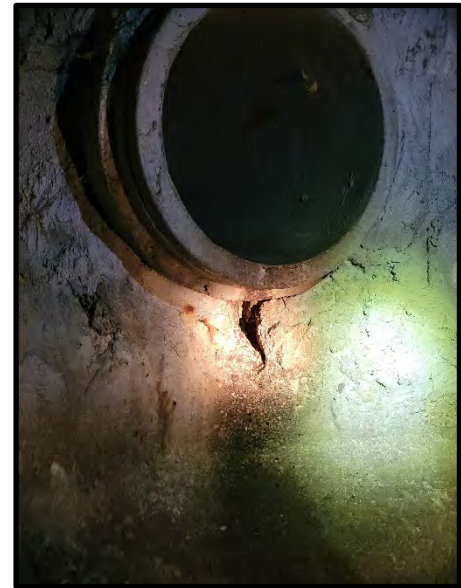

## Markwood Overflow (Crystal)



## Markwood 8 feet x 4 feet Box Culvert (Crystal)



Georgia Avenue Crossing (Crystal)



Edgewood Embankment (Crystal)



Douglas Drive Crossing (Crystal)







34th Avenue Crossing (Crystal)



Brunswick Avenue Crossing (Crystal)



Brunswick Avenue Crossing (Crystal), continued

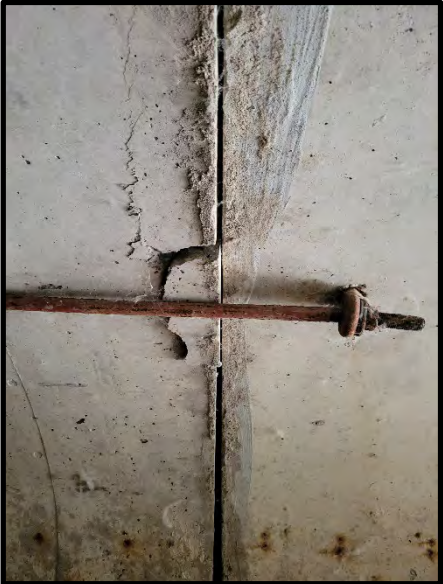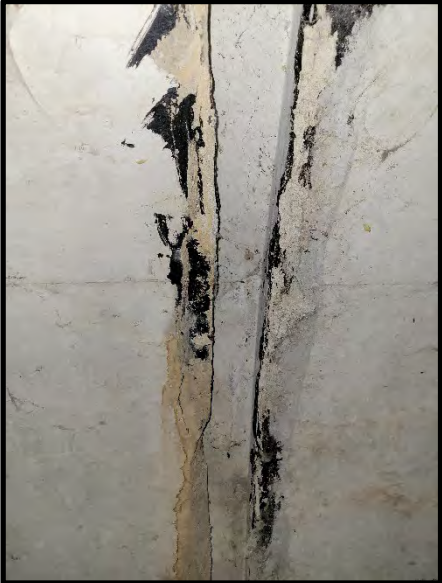

Channel between Brunswick Avenue Crossing and 32<sup>nd</sup> Avenue Crossing (Crystal)



# 32nd Avenue Crossing (Crystal)



Bassett Creek Park Pond and Outlet (Crystal)



Detention Pond and Outlet Structure (Crystal)



Highway 100 Double Box Culverts (MnDOT Responsibility, Located in Crystal/Golden Valley)




Highway 100 Double Box Culverts, continued





Open Channel (Minneapolis)

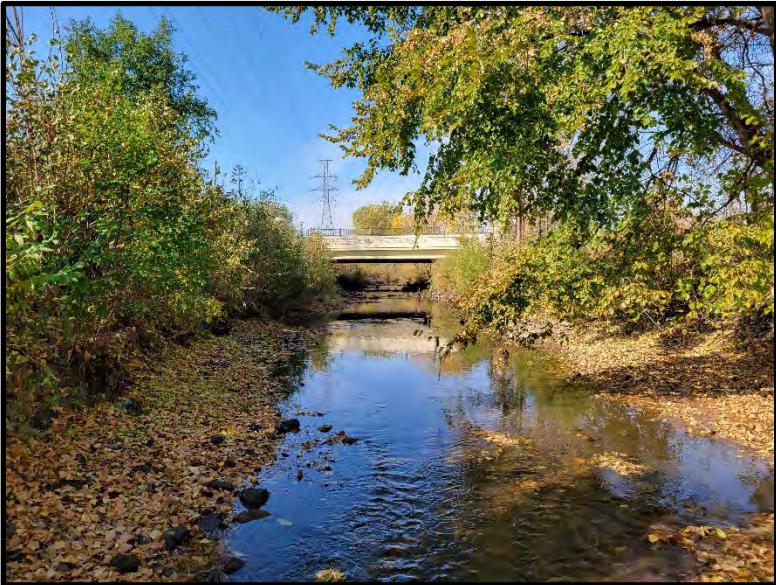

Debris Barrier (Minneapolis)



# Inlet Structure (Minneapolis)

