



**Appendix B.**  
**2017 Main Stem Erosion**  
**Repair Project**  
**Feasibility Report, May 2016**

Barr Footer: Date: 9/29/2009 5:12:09 PM File: I:\Client\BassettCreek\Work\_Orders\Streambank\_Erosion\_Assessments\Maps\Meetings\Mpls\_Park Board Erosion Survey.mxd User: TJA

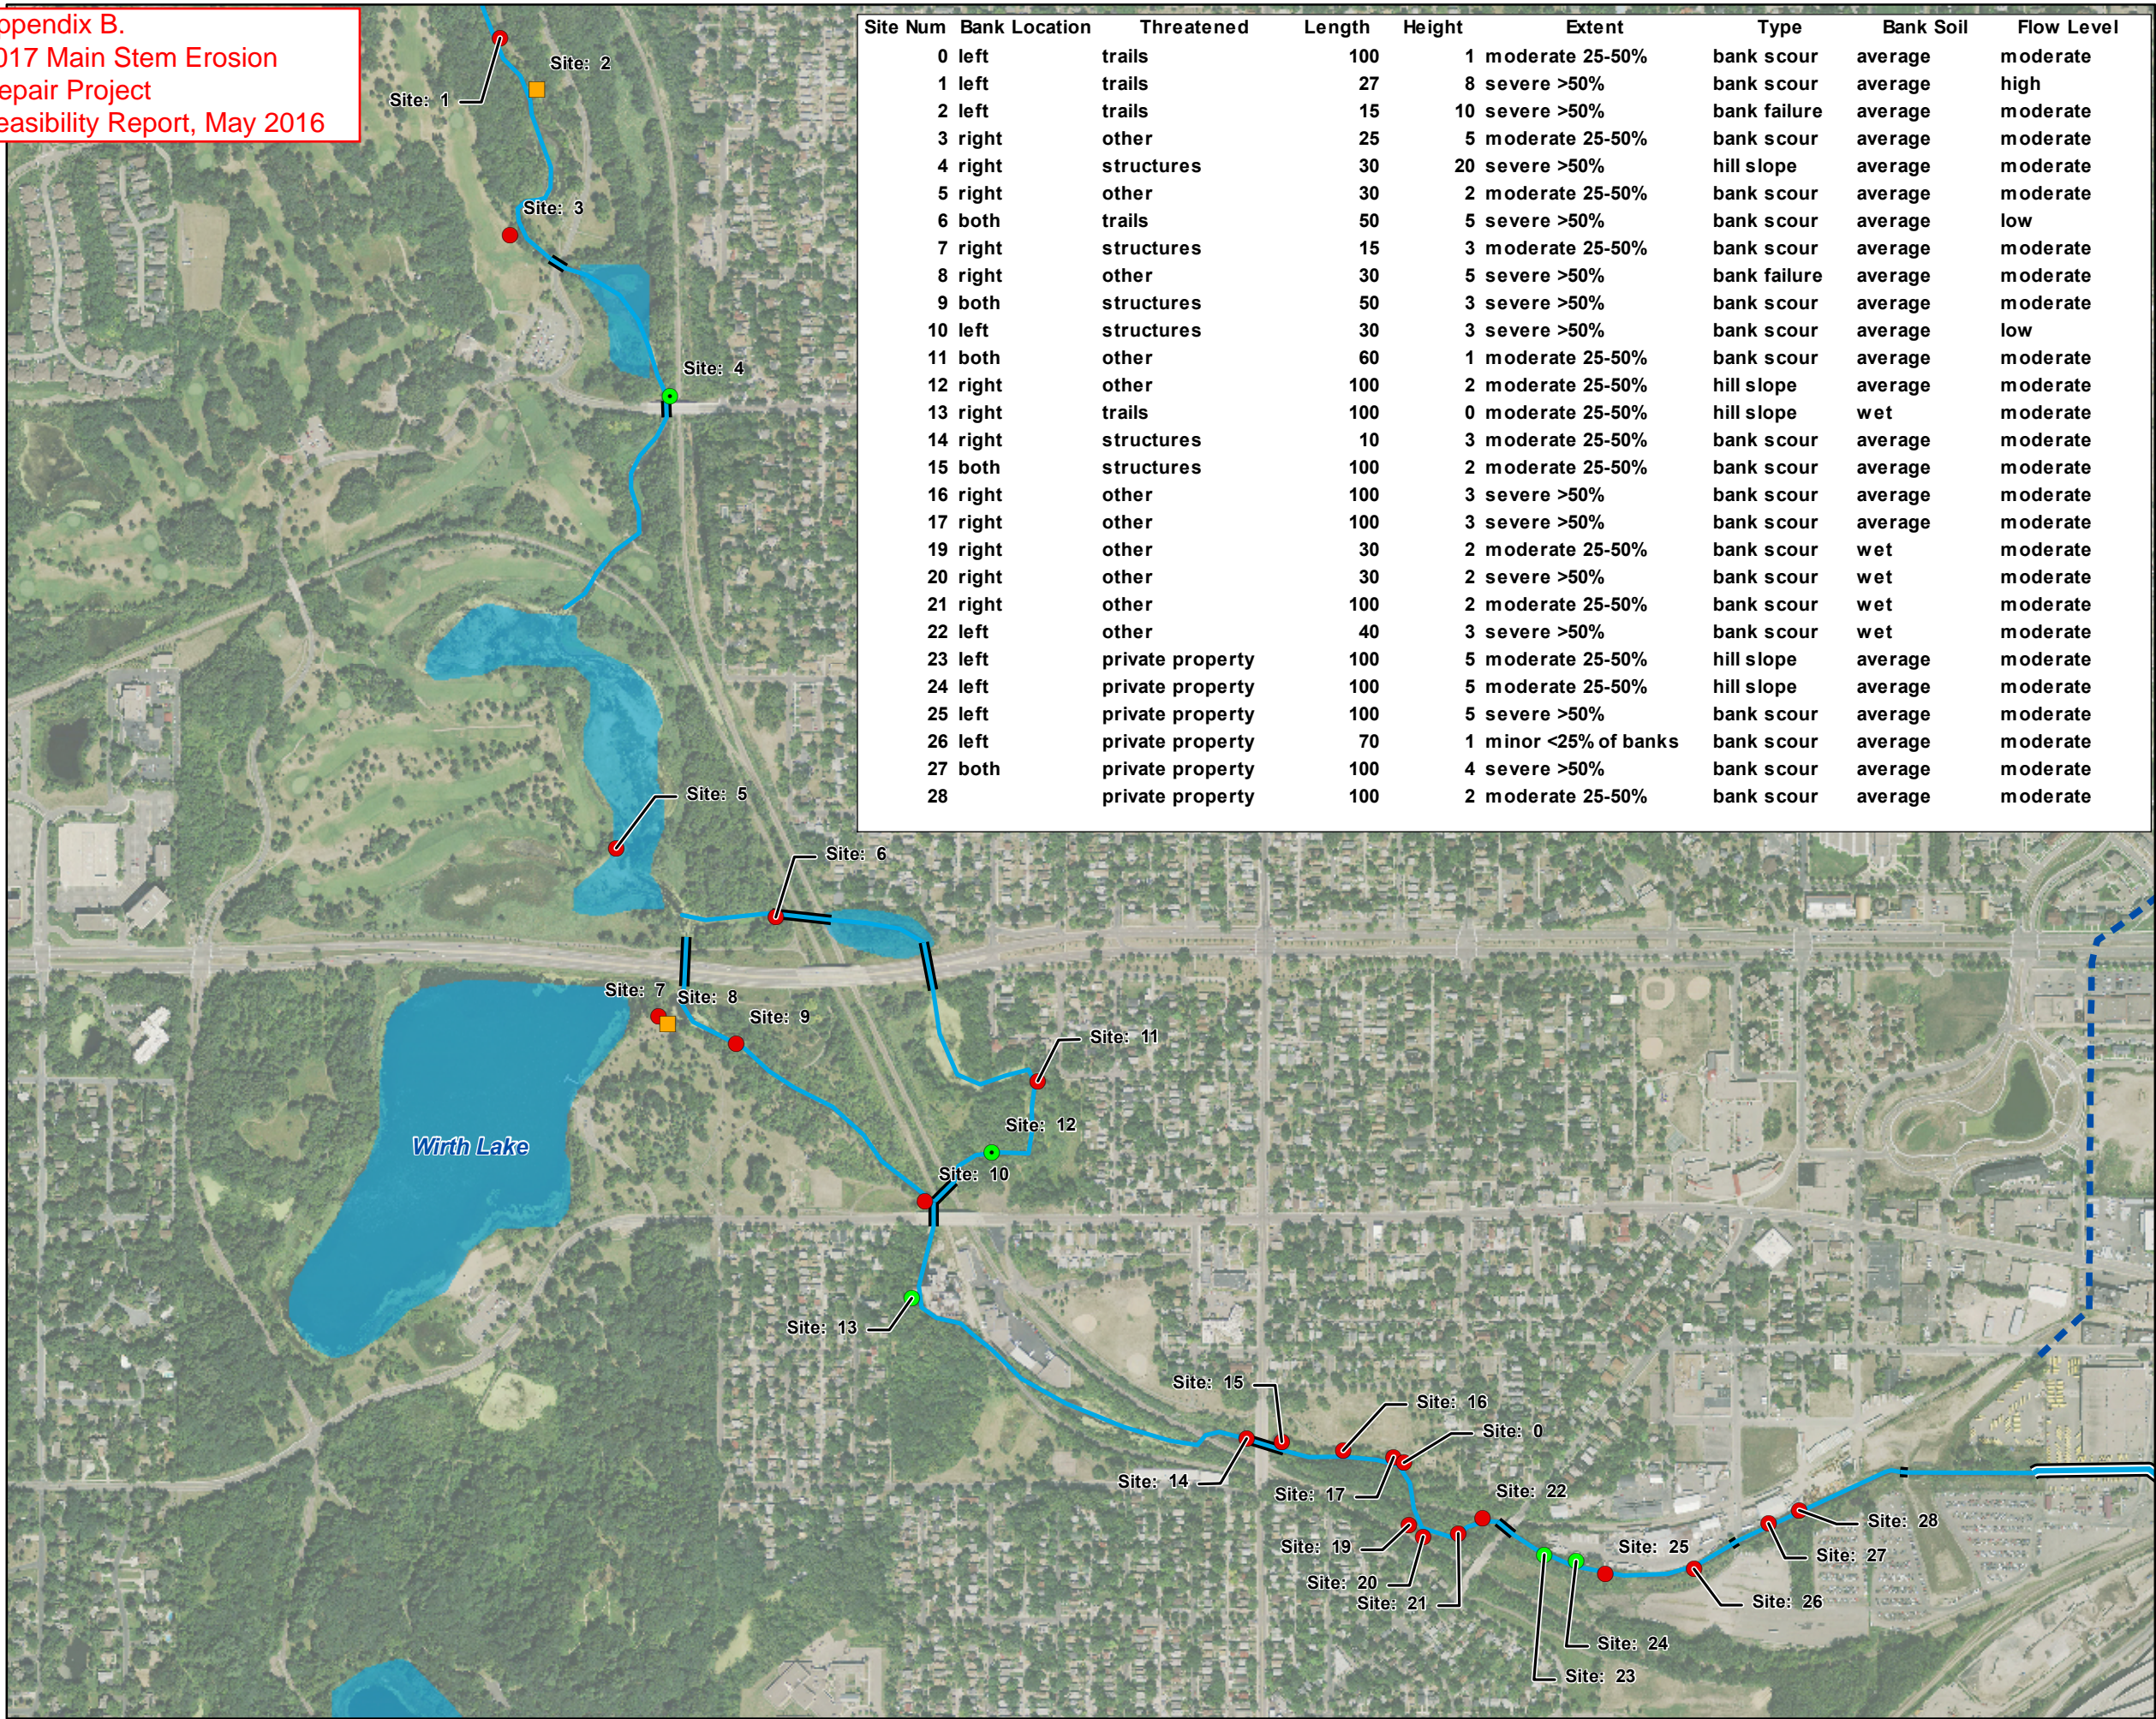

Site Num	Bank Location	Threatened	Length	Height	Extent	Type	Bank Soil	Flow Level
0	left	trails	100	1	moderate 25-50%	bank scour	average	moderate
1	left	trails	27	8	severe >50%	bank scour	average	high
2	left	trails	15	10	severe >50%	bank failure	average	moderate
3	right	other	25	5	moderate 25-50%	bank scour	average	moderate
4	right	structures	30	20	severe >50%	hill slope	average	moderate
5	right	other	30	2	moderate 25-50%	bank scour	average	moderate
6	both	trails	50	5	severe >50%	bank scour	average	low
7	right	structures	15	3	moderate 25-50%	bank scour	average	moderate
8	right	other	30	5	severe >50%	bank failure	average	moderate
9	both	structures	50	3	severe >50%	bank scour	average	moderate
10	left	structures	30	3	severe >50%	bank scour	average	low
11	both	other	60	1	moderate 25-50%	bank scour	average	moderate
12	right	other	100	2	moderate 25-50%	hill slope	average	moderate
13	right	trails	100	0	moderate 25-50%	hill slope	wet	moderate
14	right	structures	10	3	moderate 25-50%	bank scour	average	moderate
15	both	structures	100	2	moderate 25-50%	bank scour	average	moderate
16	right	other	100	3	severe >50%	bank scour	average	moderate
17	right	other	100	3	severe >50%	bank scour	average	moderate
19	right	other	30	2	moderate 25-50%	bank scour	wet	moderate
20	right	other	30	2	severe >50%	bank scour	wet	moderate
21	right	other	100	2	moderate 25-50%	bank scour	wet	moderate
22	left	other	40	3	severe >50%	bank scour	wet	moderate
23	left	private property	100	5	moderate 25-50%	hill slope	average	moderate
24	left	private property	100	5	moderate 25-50%	hill slope	average	moderate
25	left	private property	100	5	severe >50%	bank scour	average	moderate
26	left	private property	70	1	minor <25% of banks	bank scour	average	moderate
27	both	private property	100	4	severe >50%	bank scour	average	moderate
28		private property	100	2	moderate 25-50%	bank scour	average	moderate



**Erosion Sites**

- Bank Failure
- Bank Scour
- Hill Slope